

Product Support Bulletin

Subject: Endeavor P60 and Windows for Workgroups 3.11

Date: 03/24/94

Page(s): 1 of 1

PSB No: S-0170

Originator: MWT

A problem may occur when accessing external serial devices (such as modems) connected to the Endeavor P60 running Windows for Workgroups 3.11. The system can lock up if there is data in the UART (Universal Asynchronous Receiver-Transmitter) chip when a serial communications application attempts to open the communications port.

Microsoft has an updated **SERIAL.386** file that corrects this problem that is available from the Microsoft Product Support Download Service (MSDL). It is contained in the self-extracting file **WG1001.EXE**, which also contains a **README.TXT** file giving installation instructions. The MSDL may be reached at (206) 936-6735.