

EB-PowerLite L570U/L770U/L775U

Firmware Release Note

3/25/2026

Mar. 9, 2026

V1.63

[Bug Fixes]

1. Fixed an issue in which initializing either of the following ESC/VP21 commands caused both commands to be initialized:
 - HREVERSE
 - VREVERSE
2. Fixed an issue in which the "Color Format" item in the Information menu was not updated periodically.

Dec. 22, 2025

V1.62

[Feature improvement]

1. Optimized the write method for the information (logs, settings, etc.) stored inside the projector.
2. Change in update frequency of information stored Inside the projector

[Bug fixes]

1. Scene Adaptive Gamma is disappeared with Web control in the following source:
 - USB
 - LAN

[Security Update]

After a password authentication failure, the next password authentication attempt is locked for 2 seconds for the following credentials:

- Web control password
- Remote password

March 26, 2025

V1.61

[Bug fixes]

1. Fixed the bug that allowed the projector to output images even when it was prohibited, if a specific operation was performed.

Feb 7, 2025

V1.60

[Feature improvement]

1. Supports Epson Projector Management Connected V2.0
2. Add the AS Info related to Optical Engine
 - POP Op. Time
 - Engine Replacement

Add the command to initialize Optical Engine information only

Operation: Press and hold both the Source Search and Left buttons for 10 seconds

A specification to initialize the Optical Engine information has been added to resetting AS Info.

Operation: Press and hold both the Source Search and Down buttons for 10 seconds.

Note: These operations are performed using the control panel on the projector only.

Additionally, these operations are executed within the AS menu only.

For repair instructions, please see the service manual.

This information does not disclose users.

[Usability improvement]

1. The following items of usability improvement related to PSTI Law
 - Users can set Monitor Password*1 from the OSD menu.
[Network settings]>[Projector Control]
 - If Monitor Password has not been set when users have set "Command Communication" to "Compatible", a dialog to set Monitor Password will pop up.
 - Users can choose whether to set Web Control password as needed, not mandatory.
- If the following condition, display the dialog to promote to set Web Control Password
- Web Control Password: have not set
 - Complete Network settings

*1: You can set it when Command Communication is set to "Compatible" only.

[Bug fixes]

1. The blend range can be set even over the maximum value.
2. Camera feature might be frozen due to remove cable of ELPEC01 just after performing camera assist.
3. Image quality might not be reverted back when selecting [Redo] after performing Screen Matching.
4. All Color Uniformity cannot be adjusted in Web control if the adjustment level from 2 to 8 is not the same value.
5. The laser may turn off after the EPSON logo is displayed.
6. Light Source Calibration may not reach the desired result.
7. In Epson Projector Management Connected, if proxy username includes "&", the export setting may fail.

Jun 24, 2024

V1.51

[Bug fixes]

1. YE warning may occur during startup or when changing the brightness.
(The warning occurs even though there is nothing wrong with the light source or sensor.)
2. A black screen may occur when inputting HDMI signals.
(more countermeasures added from V1.13)


Mar 26, 2024

V1.50

[Compatibility with new models]

1. Support Epson Projector Professional Tool(EPPT) V1.52

[Usability improvement]1. The words in the dialog displayed by executing Export/Import Batch settings of OSD menu have been changed. V1.50 or above

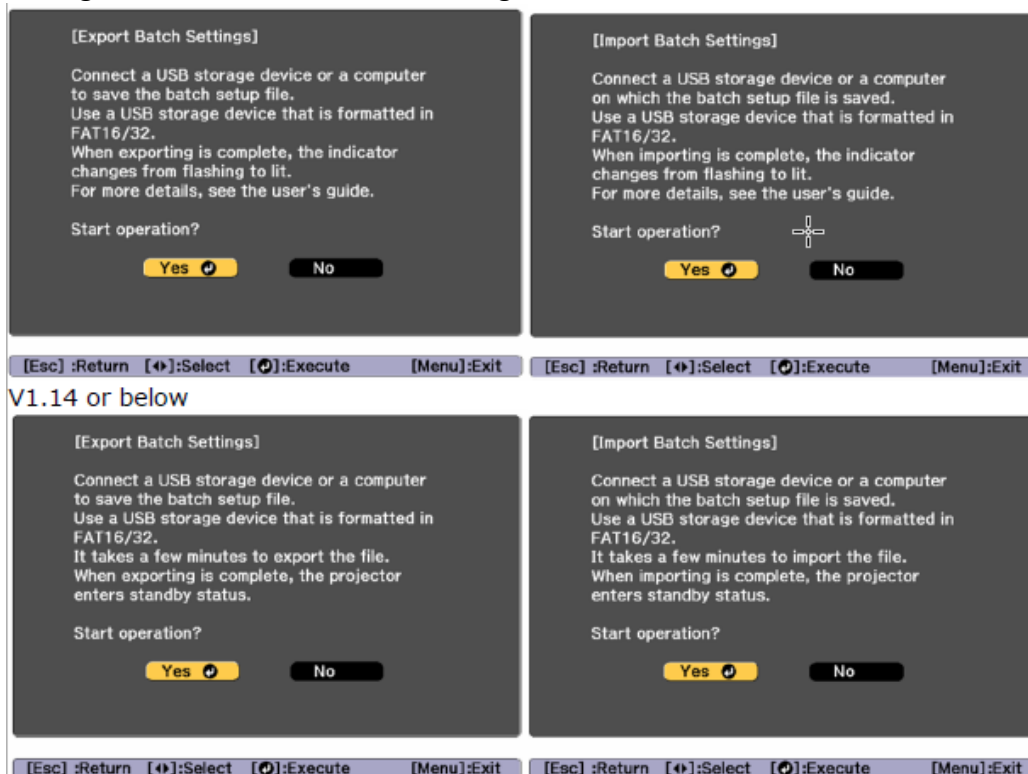

[Bug fixes]

Fixed bugs as follows:

1. Stacking display is shifted after executing Curved surface stacking assist of EPPT.
2. The dialog of Crestron Connected Password kept displaying.

Jan. 12, 2024

V1.14

[Feature improvement]

1. Add the item of "Basic control" in Network Setting. Location: Network > Network Configuration > Others > Basic Control Function: When using "Basic Control" function in Web Control, login by "Remote Password" is enable/disable.
2. Add the item of "Batch file Export/Import" in OSD menu. Location: Info > Export/Import Batch Settings Function: Enables export/import of batch setting file during unit is working, which was previously supported only by special key operations* during non-startup. *Export: AC connect while pressing ESC button Import: AC connect while pressing MENU button.

[Usability improvement]

1. Changed the timing of setting "Web Control Password" and "Remote Password"
 - I. Web Control Password: Password to control/monitor the projector on the Web Control Less than V1.14: Enter the Network Menu without setting a password. V1.14 or above: Complete the Network Settings without setting a password.
 - II. Remote Password: Password only available in "Basic Control" on Web Control Less than V1.14: Enter the Network Menu without setting a password V1.14 or above: "Basic control" will be set from off to on without setting a password.

2. Add the language Vietnam. (Exclude: ECC model) [Bug fixes]

Fixed bugs as follows:

1. Firmware update could be failed with Epson Projector Management Tool.
2. Crestron Connected Version2 may not be available after Firmware update.
3. Fixed typographical and operational bugs in Web Control.
4. EventID: 0899 occurs when Simple AP is "off" and SSID is "empty" (default value)

[Security update]

1. OpenSSL module version is updated to 3.0.9.

Jul. 24, 2023

V1.13

[Bug fixes]

Fixed bugs as follows:

- 1) Sometimes, when the HDMI signal displays a black screen (more counter measure added from V1.11).

Jul. 11, 2023

V1.12

[Bug fixes]

V1.12 includes the following bug fixes because V1.11 did not include. Sometimes, when switching the signal, the projector cannot display

Jun. 13, 2023

V1.11

[Feature improvement]

- 1)Compliant with Chinese national standard GB18030-2022.
- 2)Time out timing of tiling arrangement settings is added as follows.

- Manual: 90 sec

- Auto: 360 sec

[Usability improvement]

- 1)A dialog of auto adjustment of simple blending is compliant with all languages.

[Bug fixed]

Fixed bugs as follows:

- 1)After network settings are initialized, the network settings reset process works even though you select "NO" in the confirmation dialog of the network settings menu.
- 2)Sometimes, when the HDMI signal is input to the projector, displays a black screen.

May 15, 2023

V1.10

[Feature improvement]


- 1)Epson Projector Professional Tool Ver. 1.50 support

- Blending and Stacking Assist Support
- Blending and Stacking Assist Support to curved area

- 2)The specifications are improved to comply with the Policy for new cyber laws in the UK "Product Security and Telecommunications Infrastructure Act 2022".

[Usability improvement]

- 1) Max grouping units' quantity increases from 8 to 14 by using web control.
 - 2) The adjusted pattern of "Simple blending" was changed.
- Addition of T-mark as a guide for adjustment. (refer below red circle)

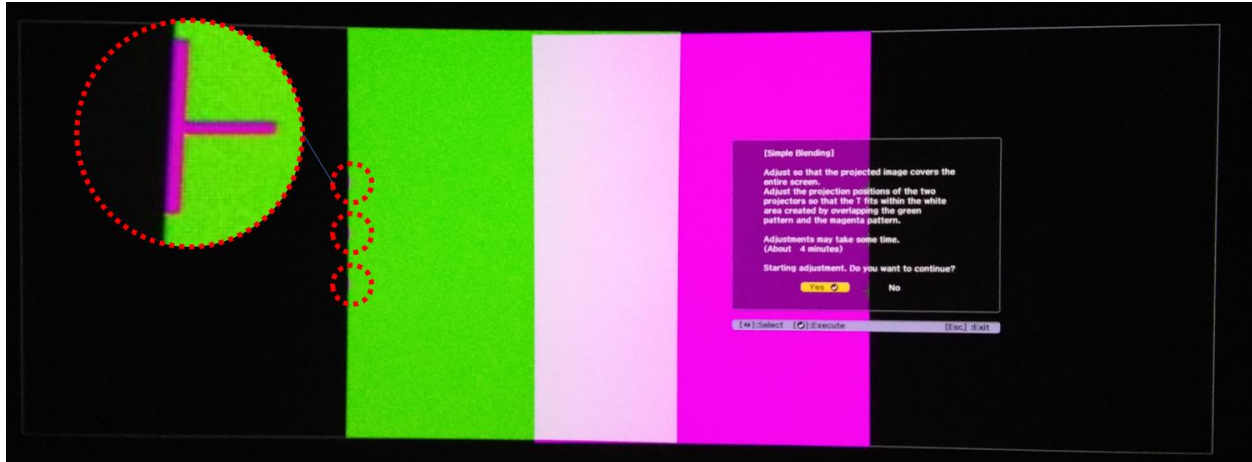

- The explanation dialog for adjustment was changed as below.

Adjust the projection positions of the two projectors so that the T fits within the white area created by overlapping the green pattern and the magenta pattern.

- When adjusting the display's shapes, the color of the selected cross anchor was changed to orange.

3) The EPSON logo was changed. (EXCEED YOUR VISION is deleted)

[Bug fixes]

Fixed bugs as follows:

1)"Dynamic Contrast" does not set to "OFF" automatically after "Screen Matching".

2)"LD temperature error" instead of "SE error" should occur when LD thermistor is not connected.

3)Epson Projector Professional Tool cannot get the projector status under projector state is network standby.

4)Display distorted after edge blending with other projector series using ELPLX01/02/03 series lens.

5)Even though the password protect setting is ON, remote and web control passwords are reset by factory reset.

6)Sometimes, when switching the signal, the projector cannot display.

Feb. 24, 2023

V1.01

Initial release for mass production